
S-32 4531
F-4/14/83
MF # 0315

CERTIFIED LAND CORNER RESTORATION - PERPETUATION AND FILING RECORD

STATE OF ARKANSAS
County of Prairie (Northern District)

Twp 5 N Rge 7 W Sec 32

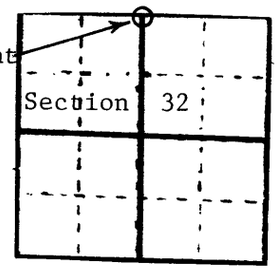

O = Corner

I, Sam F. Word
RLS 14 certify that on the 25th day of March, 1982, found evidence of the North ¼ corner of Section 32 Township 5 N, Range 7 W of the Fifth Principal Meridian, and that I have established a new monument and accessories as described hereon to perpetuate the location of this corner and that the found evidence and restored monument and accessories are correctly shown.

IN WITNESS WHEREOF, I have hereunto set my hand and stamp this 25th day of March, 1982.

FILE: 8203-5463

Sam F. Word

STATE OF ARKANSAS
SAM F. WORD
SEAL
REGISTERED SURVEYOR
MONROE COUNTY

LSD 76-1

Description of Original Corner

GLO-(Original Survey)-James Trimble, D.S., February 17, 1820, set a post corner from which:

1. 12" Black Oak bears N25°E, 16 lks.
2. 8" White Oak bears S47°W, 20 lks.

GLO-(Resurvey)-J.J. Bean, D.S., February 22, 1848, set a post corner from which:

3. 13" Black Oak bears N31°W, 25 lks.
4. 16" Black Oak bears S63°30'W, 32 lks.

Description of Corner Evidence Found


Existing 1½" Iron Pipe lies 28.0' south of corner on south right of way line of Arkansas Highway 13 (gravel surface) from said Quarter corner:

1. N25°E, 16 lks. - No Evidence
2. S47°W, 20 lks. - No Evidence
3. N31°W, 25 lks. - No Evidence
4. S63°30'W, 32 lks. - No Evidence

FILED
JUN 4 1982
Mary Brown
BILLY M. GARRI
CIRCUIT AND COUNTY CLERK
PRAIRIE COUNTY

Point of the corner determined by: Existing Monument, Extensive land tie control within area, previous surveys and general use and acceptance by adjoining land owners.
Description of monument accessories I established to perpetuate the location of this corner.
Set aluminum pipe 2½" diameter, 30" long with cast aluminum breakaway base and 3½" cap embossed "Arkansas Geological Commission Land Survey Division" marked 28' south of corner as shown:
Set top of monument 6" below surface of ground beside existing 1½" iron pipe from which:

5. S36°E, 27.0'-18" Oak
6. N89°W, 123.0' -Power Pole
7. South, 458.09' - Existing 5/8" rod & cross-tie
8. South, 1292.00' - 5/8" rod, SW corner, N½-NE¼, Section 32, T5N-R7W
9. South, 2612.00' - Existing stone at base of cross-tie in east-west fence, Southwest corner, NE¼, Section 32, T5N-R7W

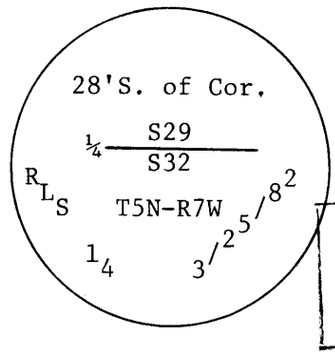

CHECKED

Field work executed by: Donald E. Sheffer, L.S.I.T. No. 20, Survey Party Chief

OFFICE OF CLERK AND RECORDER: (Show filing data)
This document was filed for record on the 4 day of May, 1982, in Book 2 Page 21.

Billy M Garrl - Co Clerk
(Recorder)
By: Mary Brown, Dc

(Show or attach other information on reverse side)

I certify that this instrument was filed for record in the Land Survey Division on the 23 day of July, 1982, and is truly recorded as Document 4531.

(State Surveyor)

Div. Ind. V7 Page 1 of 1. Film Ind.