
21605
Document Number
(DLS use only)

County: PIKE

Certified Land Corner Restoration Perpetuation and Filing Record
Division of Land Surveys, Little Rock, AR 501-683-1666

S: 36 T: 08 S R: 24 W

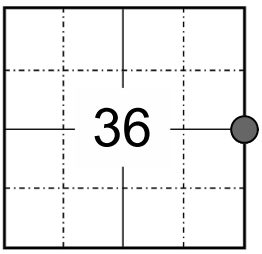

Corner EAST QUARTER GCDB number 700140 Accuracy (ft) 0.14'
Latitude / Longitude (required) 34°00'29.99736"N, 93°30'28.73378"W
Surveyor KYLE PENNINGTON PS number 1807 Survey Date 12-01-2020
Previous certificate on file? YES If so, list doc # 005526 Horz Datum NAD83(2011)
Position determined by TRIMBLE R12 GPS RTK CONTROL OBSERVATION ADJUSTED TO LOCAL POINT PROCESSED THROUGH 3-HOUR NGS OPUS OBSERVATION.

Description of original and perpetuating surveys

February 1819: John Bivins, D.S. set a ¼ Section Post, from which:
1. 12" Black Oak: N70°W, 6 Links (3.96')
2. 24" White Oak: S79°E, 26 Links (17.16')

Certified Corner #005526 (also filed at Pike County Survey Book G, Page 49):
March 15, 1982: Fred DeAryan, PLS #0902, found a railroad rail at a fence corner running East-South in-line with West-running fence, which measured well with established corners North-South and sets a standard 2" Aluminum Monument with "Arkansas Geological Commission" Cap over broken glass by railroad rail from which:
3. 6" Pine: S27°E, 12.45'
4. 14" Pine: N33½°E 13.30'
5. 11" Pine: S39½°E 4.4'
   Steel post with witness sign and location tag: East, 1.0'

Corner additionally used as West Quarter Corner of Section 31, T-08-S R-23-W in boundary survey as found in Pike County Survey Book P, Page 71.

Description of evidence found

On June 05, 2020, I find Mr. DeAryan's AGC monument in good condition projecting 4 inches, being 1.0 foot west of a witness sign on steel post. From said monument is:

1. No Evidence
2. Stump hole (15"x15"x5"): S85°E, 17.65' (questionable)
3. 8" Pine: S27°E, 12.45'
4. Stump hole (21"x21"x6"): N33°E, 13.40'
5. 12: Pine: S40°E, 4.30'

Description of monument/accessories established to perpetuate corner location

Accepted Mr. DeAryan's monument from 1982 as located based on existence of monument, #3 and #5, and evidence of #4 and on December 01, 2020 I re-fresh markings on #3 and #5 take the following:
6. 5" Sweet Gum: N43°E, 12.70'
7. 4" Wood Fence Corner Post: N87°W, 111.55' (across Highway #195)
   Center of Highway #195, through a curve, is approximately 67.8' west of corner in-line with #7.

#3, #5, and #6, each marked with Bearing Tree tag and the following: orange belt at 5 feet, scribed "WT" at base facing monument, and 60-D Mag-Hub nail in side perpendicular to monument. #7 marked with Location Tag and orange belt.

Certify Here

LICENSED PROFESSIONAL SURVEYOR
STATE OF ARKANSAS
No. 1807
SIGNATURE
KYLE PENNINGTON
12-24-2020

Mark one of the following: Original Corner Type A/B ○ Re-established Corner Type C ○ Existing Corner Type C ●

I, KYLE PENNINGTON PS# 1807 certify on this date 12-01-2020 that evidence was found for the corner describe and I have established monument and accessories to perpetuate the corner position as shown and sketched hereon


Division of Land Surveys Use only
I certify that this instrument was filed for record with the Division of Land Surveys

Date 12/31/2020 State Surveyor

Certified Land Corner Restoration Perpetuation and Filing Record
Division of Land Surveys, Little Rock, AR 501-683-1666

Location Sketch

Sec: 36 **Twp:** 08 S **Rge:** 24 W

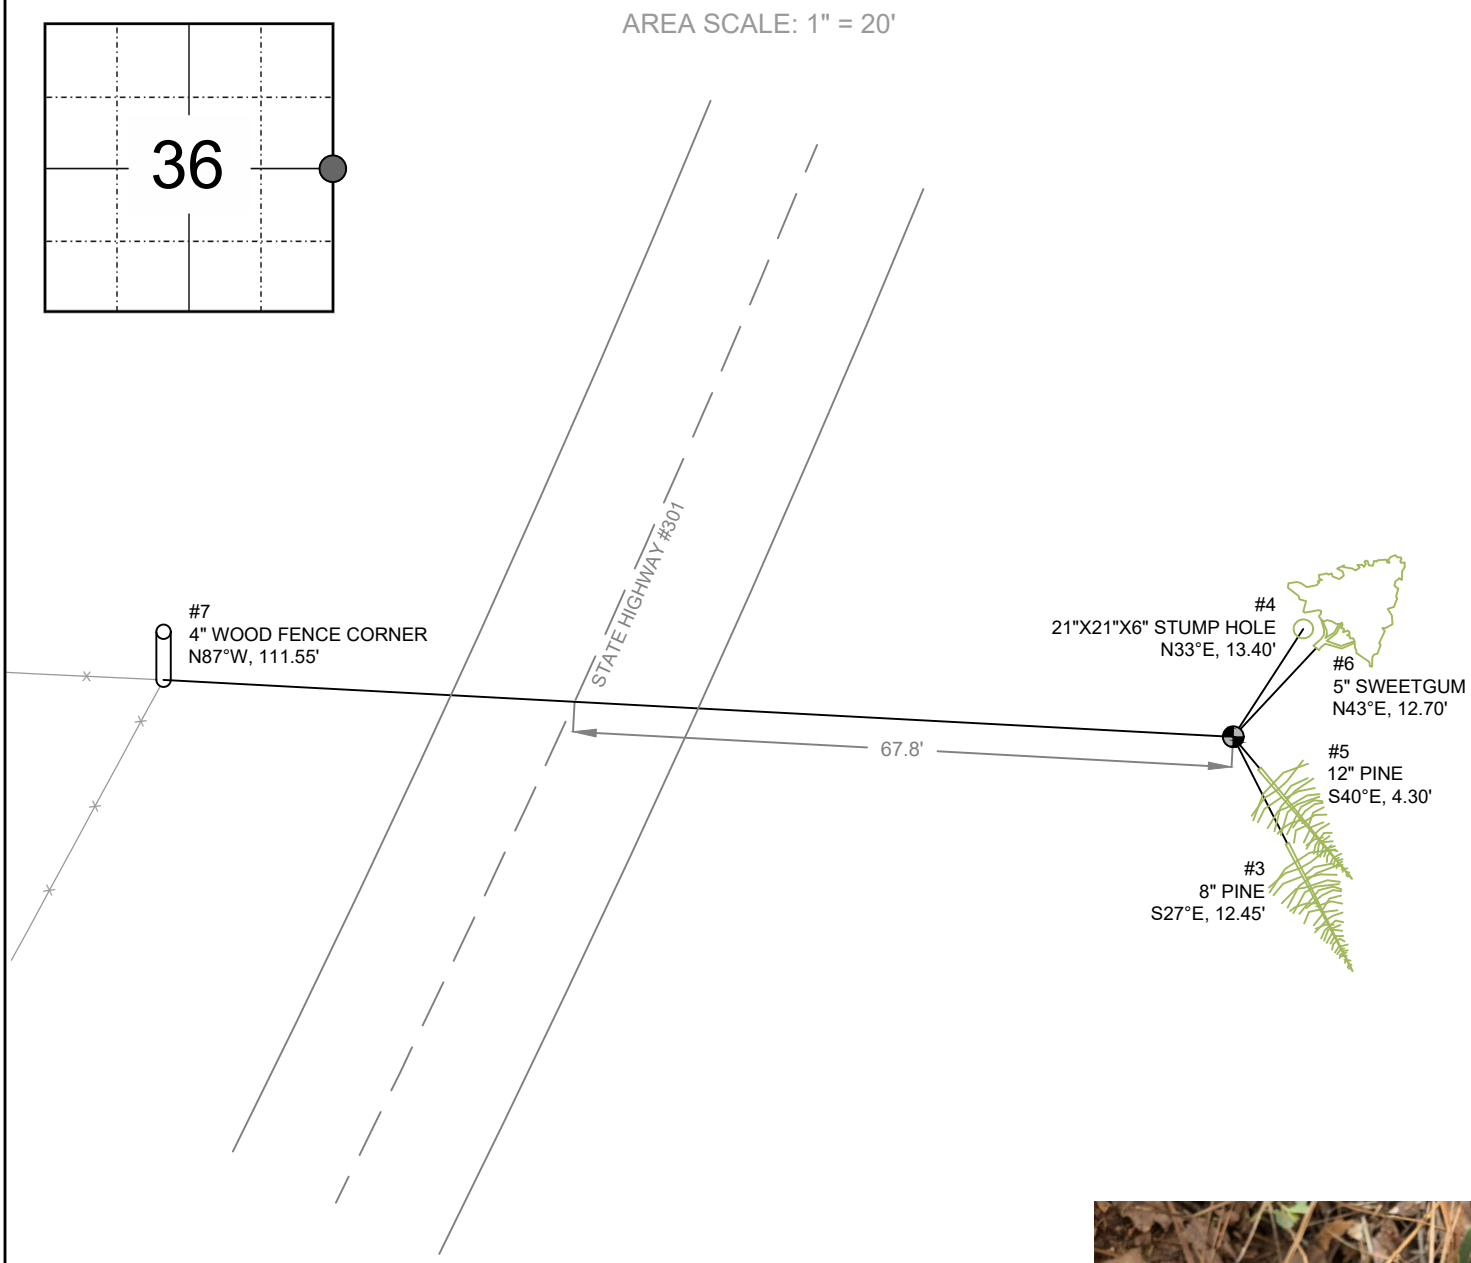

LICENSED PROFESSIONAL SURVEYOR
STATE OF ARKANSAS
No. 1807
SIGNATURE
KYLE PENNINGTON
12-24-2020



Legacy Index Number X-25



#3: BEARING TREE TAG ON 8" PINE
S27°E, 12.45'



#5: BEARING TREE TAG ON 12" PINE
S40°E, 4.30'



EXISTING WITNESS SIGN/LOCATION TAG DETAIL



AREA VIEW FROM NORTHWEST:
MONUMENT IN FOREGROUND
LOCATION TAG AND WITNESS SIGN 1.0' BEHIND TO LEFT
#5 WITH I.P./POTLATCH MARKINGS DIRECTLY BEHIND
#3 FURTHER BEHIND TO RIGHT



#6: BEARING TREE TAG ON 5" SWEETGUM
N43°E, 12.70'



#7: LOCATION TAG ON 4" WOOD FENCE CORNER POST
N87°W, 111.55'



#6 FROM MONUMENT



#7 FROM MONUMENT DIRECTION