
County: Chicot

S: 26 T: 16S R: 01W

Certified Land Corner Restoration Perpetuation and Filing Record
Division of Land Surveys, Little Rock, AR 501-683-1666

Document Number (DLS use only)
33085

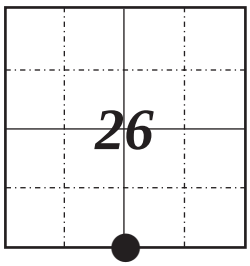

Corner S 1/4 GCDB number 540200 Accuracy (ft) 0.5
Latitude / Longitude (required) Lat:33°16'11.177" Lon:91°10'26.102"
Surveyor Steven S. Martin PS number 1564 Survey Date 10-06-2021
Previous certificate on file? No If so, list doc # _____ Horz Datum NAD83(2011)
Position determined by Geomax 35 Pro using ArDOT RTX Network

Description of original and perpetuating surveys

1823 William V. Rector D.S. original G.L.O. set ¼ sec. post on true line between sections 26 & 35 from which:
(1) a S. Gum 48 in. dia. brs. N11°E 10 lks.
(2) a Hackberry 8 in. dia. brs. S51°E 50 lks.

AHTD plat of 08-11-2014 by John Mitchell PS 1199, Land Survey Division Doc.#201408140002 reference found 1½" pipe at this location.

Description of evidence found

10-06-2021 I find 1½" Pipe in harmony with,½" Rod found at SW corner and CPS at SE corner of 26-16S-01W as per AHTD plat, Land Survey Division Doc.#201408140002. No evidence of the original witness trees are found as this land has been extensively cultivated.

Description of monument/accessories established to perpetuate corner location

10-06-2021 I set a standard type (A-2-BR) AR Land Survey Division Monument at the location of the 1½" pipe over clear broken glass 8" below ground level and on the south edge of a field road. The was left in the hole as a memorial. I take the following Witnesses:
(3) the south C-L fence corner of a gas valve enclosure N2°07'11"W 1619.50'
(4) an Arkansas Land Survey Division (A-02-BR) set at ½" rod, SW corner Sec. N89°35'03"W 2615.92'
(5) a CPS found at SE corner of Sec. S89°31'57"E 2618.37'
(6) a "Do Not Disturb" sign and Location tag on a "U" Post, South 10.0'



Mark one of the following: Original Corner Type A/B ○ Re-established Corner Type C ○ Existing Corner Type C ◉

I, Steven S. Martin PS# 1564 certify on this date 10-06-2021 that evidence was found for the corner describe and I have established monument and accessories to perpetuate the corner position as shown and sketched hereon

Division of Land Surveys Use only

I certify that this instrument was filed for record with the Division of Land Surveys

Date 10/7/2021 State Surveyor _____

Certified Land Corner Restoration Perpetuation and Filing Record
Division of Land Surveys, Little Rock, AR 501-683-1666

Location Sketch

Sec: 26 Twp: 16S Rge: 01W



bearings are grid north
ASP zone south

GAS VALVES

C-L FENCE CORNER
(3) N 02° 07' 11" W
1619.50'

LICENSED PROFESSIONAL SURVEYOR
STATE OF ARKANSAS
No. 1564
SIGNATURE
STEVEN SAMUEL MARTIN

10-07-2021

N 89° 35' 03 W 2615.98'

(6) ALSD
ALUMINUM CAPPED
MONUMENT

SW CORNER
Sec. 26 16S 01W

S 89° 31' 57" E
2618.37'

(4)
COTTON PICKER
SPINDLE
& CO. ROAD

SE CORNER
Sec. 26 16S 01W

(5) "DO NOT DISTURB" SIGN
& LOCATION TAG
SOUTH 10.0'



Legacy Index Number



(6) SW corner sec. 26





(5) sign on “U” post





(4) CPS in center of road







(3) C-L fence corner

E	B't'n Sec 1 & 12 T 16 S R 1 W on true line
0.28	Mississippi Set post cor for Sec 1 & 12 from which a Persimmon 14 In Dia brs N 43 W 21 L & a B Oak 24 In Dia brs S 6 E 88 L--
	Land Tim & Ug Same Thence up the River with its Meanders Thro Sec. 1 T. 16 S. R. 1 W.
	N 2 E 15.00 81.35 N 8 E 12.00 N 16 E 25.00 N 24 E 12.00 N 16 E 17.35 post Cor on the Standard line---
N	B't'n Sec 1 & 2 T 16 S R 1 W
4.96	an Ash 20 In Dia
40.00	Set ¼ Sec post from which a Hackb'y 12 In Dia brs N 77 W 7 L & a Do 9 N 76 E 22 L
68.40	a S. Gum 36 In Dia
79.00	Intersected T line E of the cor ~~480~~ 22 L Set post cor for Sec 1 & 2 from which a Hack'y 8 In Dia brs S 26 E 59 L & a H Locus 9 In Dia brs S 63 W 80 L.
	Land Timber & Ug Same
N	B't'n Sec 34 & 35 T 16 S R 1 W.
29.50	a S Gum 20 In Dia
40.00	Set ¼ Sec post from which a ~~S Gum 30~~ Pawpaw 6 In Dia brs S 48 W 25 L & an Elm 8 In Dia brs N 57 E 37 L--
41.17	a S Gum 36 In Dia
80.00	Set post cor for Sec. 26. 27 34 & 35 from which a a S Gum 24 Ø In Dia brs N 87 E 13 L & a ~~Hack'y~~ Do 28 In Dia brs S 54 E 35Ø L
	Land 1st rate Soil Tim. Oak Ash Cottenwood S Gum &C U. G. Cane Vines briers &C
East	B't'n Sec 26 & 35 T 16 S R 1 W on a random line
40.00	Set temporary ¼ S post
79.92	Intersected N & S line N of cor 32 L
West	B't'n Sec. 26 & 35 on true line
39.96	Set ¼ Sec post from which a S Gum 48 In Dia brs N 11 E 10 L & a Hackb'y 8 In Dia brs S 51 E 50 L----
	Land Timb' & Ug Same---- Nov 9th 1823-