Certified Land Corner Restoration Perpetuation and Filing Record

2006-777

Land Survey Division
Commissioner of State Lands
109 State Capitol Building
Little Rock, Arkansas 72201

STATE OF ARKANSAS
COUNTY OF DALLAS
I, Circuit Clerk and Ex-Officio Recorder for the county aforesaid, do hereby record that the annexed foregoing instrument of writing was filed for record in my office on the 6 day of June 2006 at 2:21 o'clock P M in June Record as instrument No 2006-777
Janice McDaniel, Clerk
Deputy

☒ ORIGINAL CORNER (original or perpetuated original corner / Type A & B)
☐ RE-ESTABLISHED CORNER (by statutory method / Type C)
☐ EXISTING MONUMENT OR PAROL EVIDENCE (Type C)

CORNER DESCRIPTION	SECTION	TOWNSHIP	RANGE	COUNTY
E¼	33	9 S	15 W	Dallas

DESCRIPTION OF ORIGINAL CORNER: (ORIGINAL & PERPETUATING SURVEYS)

July 20, 1821, James M. Harbison, D.S. set a post corner and marked 2 trees: (1) 15" W. Oak N38W 4 lks. (2) a Pine S87E 11 lks. (no size given)
Nov. 18, 1889, County Surveyor Isaac Holmes marked (3) 5" Elm N11W 30 lks. and (4) 12" Post Oak N6E 37 lks.
Nov. 7, 1962, Lee Adair, surveyor for Fordyce Lbr. Co. found a Pine knot and the #1 tree standing dead and the Pine stump hole of #2. he also found (5) figures on a 14" Beech 10E 12½ lks. by County surveyor. He set a 4" x 3' iron pipe w. brass cap and marked 2 trees: (6) 9" Holly N70W 34 lks. (7) 12" Beech S80E 48½ lks.

DESCRIPTION OF EVIDENCE FOUND:

05-09-2006, after finding Adair's monument with brass cap knocked out of the ground leaning in its hole, reset in original hole and found small stump hole of #1 in skidder rut. at #2 a 10" Pine stump (apparently growing out of OBT stump hole.) #3 standing alive with figures on North face now 18" diameter
(6) stump hole with Holly sprouts
(7) large stump hole 4' diameter x 20" deep
(8) red "A" and location tag on 22" Beech S40W 30.4'
(9) red "x" and "lizard" on 20" Beech S78W 18.8'
red/orange lines S & W
Clearcut NW, NE, SE recently

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE LOCATION OF THIS CORNER:

Reset existing iron pipe with brass cap level with the ground.
I marked 4 trees with a band at 6 feet with base blazed, scribed "WT" and notched with pk nail in notch.
(5) 18" Beech S10E 8.25'
(8) 10" Beech S70W 28.9' (location tag)
(9) 9" Pine N84W 48.3'
(10) 7" Sw. Gum N70E 45.4'
placed warning sign @SW 4 feet and bearing tree tags on 8, 9 & 10.
added B, 1014, 2006

GEOGRAPHIC CORNER POSITION	Latitude	Longitude	Elevation (meters)	Datum	Positional Tolerance
	33° 53' 48"	92° 38' 05"	72.8	WGS84	±30 M

POSITION DETERMINED BY:
DeLorme Topo Quad

I, Lamar Kelley PLS # 1014 certify on this date May 9, 2006 that evidence was found for the corner described and I have established monuments and accessories to perpetuate the corner position as shown and sketched hereon.

LAND SURVEY DIVISION USE ONLY

DOCUMENT NUMBER
14801


INDEX NUMBER
X13

I certify that this instrument was filed for record with the Land Survey Division on this date
5-16-2006
State Surveyor


(LSD FORM REVISED 06/17/2005)

33 SECTION | 9 S TOWNSHIP | 15 W RANGE

LOCATION SKETCH

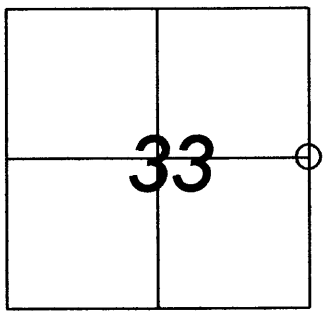

O - INDICATES CORNER

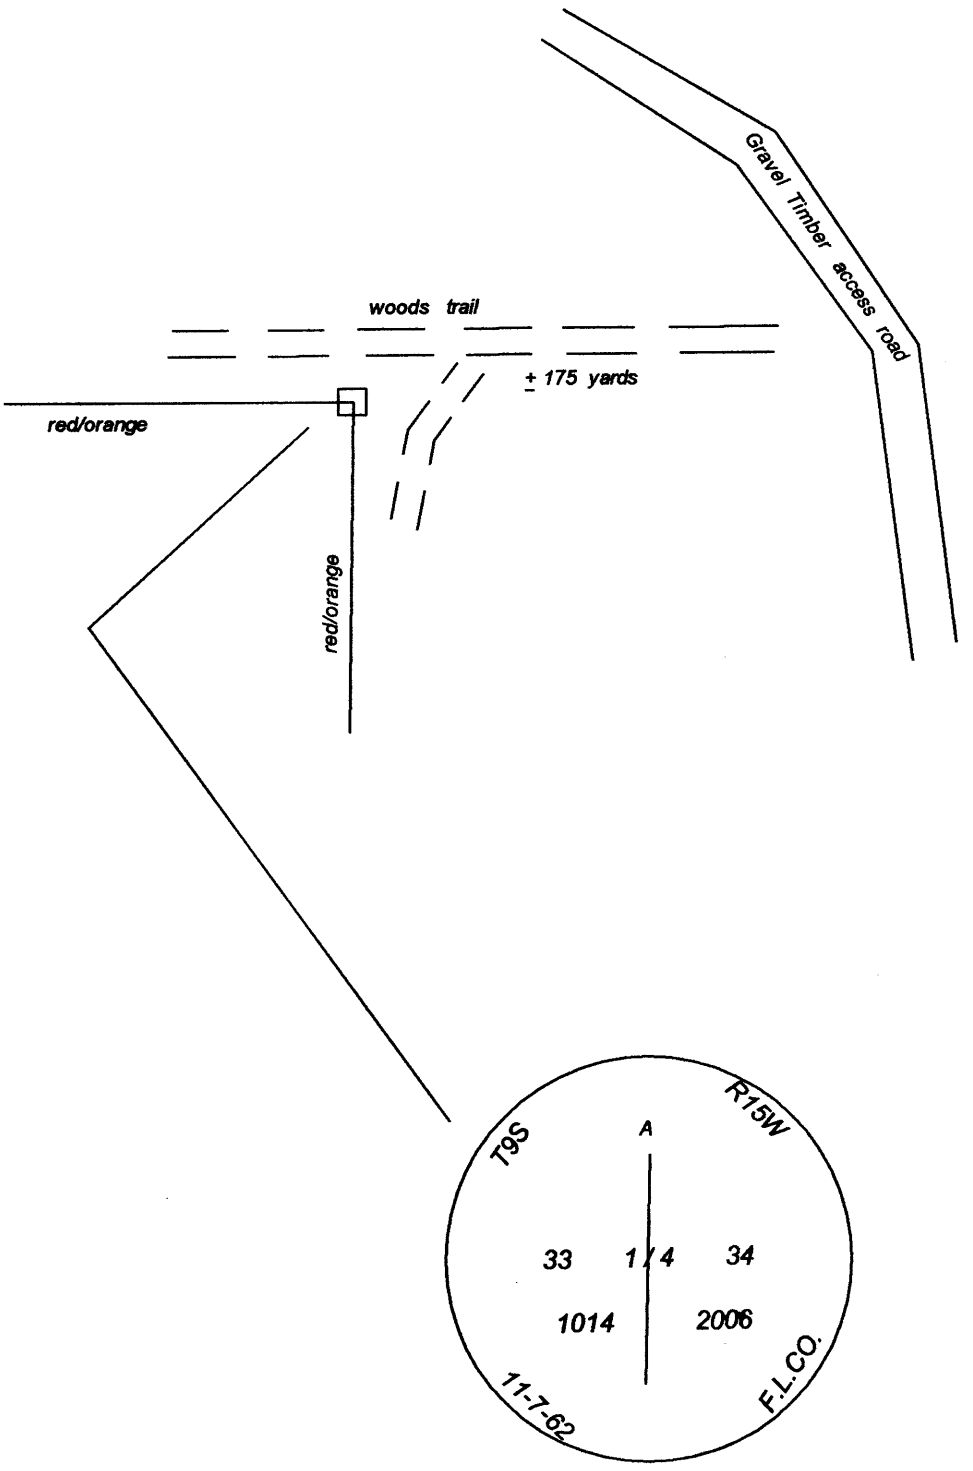

Lamar Kelley

Lamar Kelley's notes are the property of Timberland Surveys, Inc. Camden, Arkansas.